4100 North 24th Street, Quincy, Illinois 62305 USA · Phone (217) 224-9600 · Fax (217) 224-9607 · www.bdcast.com · bdcast@bdcast.com



January 31, 2011

BROADCAST ELECTRONICS TECHNICAL SERVICES

Recipients of this Technical Update receive notices from BE Technical Services on product updates and other information for users of BE equipment.

BE SUPPORT

Radio Transmitters & RF Products

Tel: 217.224.9617 rfservice@bdcast.com

Software Updates Available for ASi 10, FSi 10, and XPi 10



On January 31st, 2011, Broadcast Electronics has released new:

ASi 10 Software, Version 4.3.2p1, FSi 10 Software, Version 4.3.2p1, XPi 10 Software, Version 4.3.2p1

The software updates, with instructions included, are available from the Broadcast Electronics Technical Services website in the Registered User Login section at:

http://www.bdcast.com/support/index.php

If you prefer to have a CD with applicable software mailed to you, contact the BE Technical Services department.

Major changes to the software from Ver. 4.3.2 to Ver. 4.3.2p1:

- 1. The built-in Audio Monitor is automatically disabled with version 4.3.2p1. Background: The Graphical User Interface (GUI) ceases to properly function after an upgrade to version 4.3.2. The issues reported have included soft buttons that no longer operate and editable data fields that appear to be blank. In these cases, a reboot of the unit has returned the GUI to normal operating conditions. It has been diagnosed that this GUI issue pertains to the built-in Audio Monitor that activates after a predefined inactivity period.
- Version 4.3.2p1 now supports the replacement ALR-1400 video card. It is also backwards compatible with the original ACG-1024 video card.
- Compatibility issues with version 4.3.2 and certain HD generators with the MB2.5 motherboard (ASUS) have been resolved with version 4.3.2.p1.

Note: Upgrading to v4.3.2p1 on the XPi 10 requires the IDi to be upgraded to v4.3.1 or newer AND the Exgine Card firmware to be upgraded to v4.0 or newer!

Note: Upgrading to v4.3.2p1 on the FSi 10 requires the IDi to be upgraded to v4.3.1 or newer!

Thank you for choosing Broadcast Electronics! www.bdcast.com

Broadcast Electronics. Legal notices